## TECHNICAL LIBRARY

AD-A092 890

WVT-QA-8001

ILLUMINATION OF CANNON TUBE BORE SURFACES FOR VISUAL INSPECTION

V. G. COMPISI G. W. JACQUES

OCT 1980





# PRODUCT ASSURANCE DIRECTORATE WATERVLIET ARSENAL WATERVLIET, N.Y. 12189

#### TECHNICAL REPORT

AMCMS No. 5397.0M.6350

Pron No. A1-9-P6350

APPROVED FOR PUBLIC RELEASE: DISTRIBUTION UNLIMITED

#### DISCLAIMER

The findings in this report are not to be construed as an official **Dep**\*tment of the Army position unless so designated by other authorized documents.

The use of trade name(s) and/or manufacturer(s) does not constitute an official indorsement or approval.

#### DISPOSITION

Destroy this report when it is no longer needed. Do not return it to the originator.

REPORT DOCUMENTATION	PAGE	READ INSTRUCTIONS BEFORE COMPLETING FORM
REPORT NUMBER	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
T008-AQ-TVW		
4. TITLE (end Subtitle) ILLUMINATION OF CANNON TUBE BORE SURFACES FOR VISUAL INSPECTION		5. TYPE OF REPORT & PERIOD COVERE INTERIM FEB 79 - SEP 80
		6. PERFORMING ORG. REPORT NUMBER
7. AUTHOR(s)		8. CONTRACT OR GRANT NUMBER(a)
V. G. COMPISI G. W. JACQUES		AMCS NO. 5397.0M.6350
PERFORMING ORGANIZATION NAME AND ADDRESS PRODUCT ASSURANCE DIRECTORATE WATERVLIET ARSENAL WATERVLIET, NY 12189		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS
11. CONTROLLING OFFICE NAME AND ADDRESS US ARMY ARMAMENT COMMAND ROCK ISLAND, ILLINOIS 61201		12. REPORT DATE OCT 80
		13. NUMBER OF PAGES
14. MONITORING AGENCY NAME & ADDRESS(II different from Controlling Office)		15. SECURITY CLASS. (of this report)
		UNCLASSIFIED
		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE

6. DISTRIBUTION STATEMENT (of this Report)

APPROVED FOR PUBLIC RELEASE: DISTRIBUTION UNLIMITED

17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)


18. SUPPLEMENTARY NOTES

19. KEY WORDS (Continue on reverse side if necessary and identify by block number)

FIBER CONNECTORS ILLUMINATION ALIGNMENT

20. ABSTRACT (Continue on reverse side if necessary and identify by block number)

To control light loss in fiber connectors it was found that the centerline of one fiber core should be aligned with the centerline of the other core. The means of obtaining this alignment and the transmission efficiency of light must be coordinated with the manufacturing efficiencies in order to obtain a practical connector design.

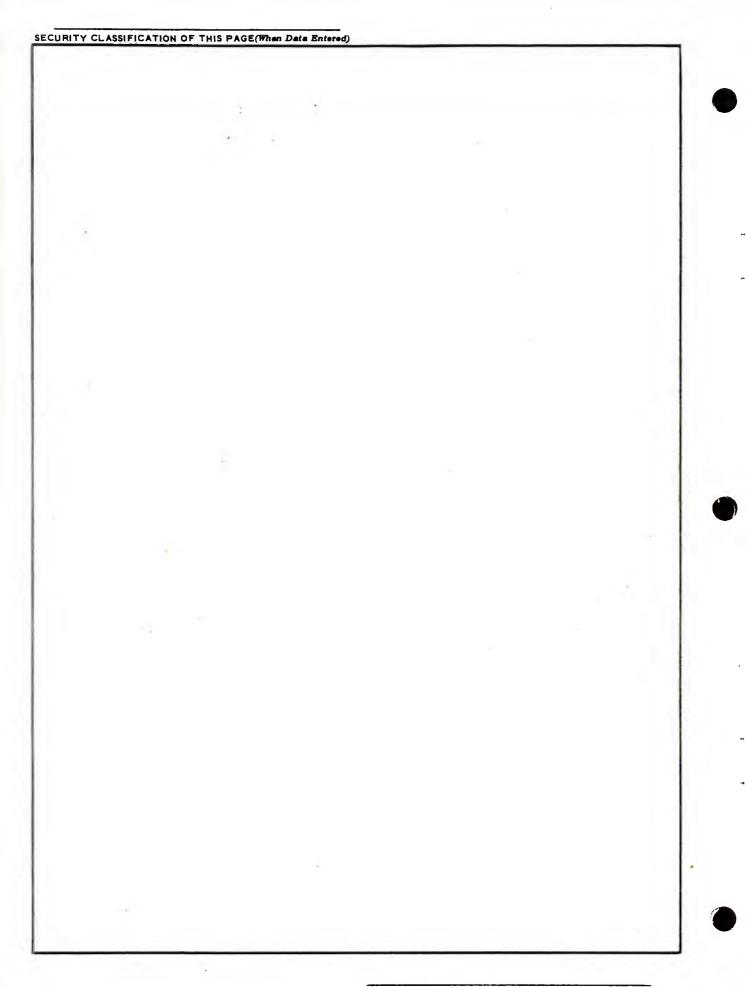

#### MATERIALS TESTING TECHNOLOGY PROGRAM (AMS 4931)

Report No.: WVT-QA-8001 Title: Illumination of Cannon

Tube Bore Surfaces for

Visual Inspection

THIS PROJECT HAS BEEN ACCOMPLISHED AS

PART OF THE US ARMY MATERIALS TESTING

TECHNOLOGY PROGRAM, WHICH HAS FOR ITS

OBJECTIVE THE TIMELY ESTABLISHMENT OF

TESTING TECHNIQUES, PROCEDURES OR

PROTOTYPE EQUIPMENT (IN MECHANICAL,

CHEMICAL, OR NONDESTRUCTIVE TESTING)

TO INSURE EFFICIENT INSPECTION METHODS

FOR MATERIEL/MATERIAL PROCURED OR

MAINTAINED BY AMC.

#### TABLE OF CONTENTS

PARAGRAPH		PAGE
	ABSTRACT	i
1	PROBLEM STATEMENT	ן
2.	BACKGROUND	2
3.	APPROACH	3
4.	EQUIPMENT USED	4
5.	SYSTEM FUNCTION	5
6.	TEST RESULTS AND EVALUATION	6
7.	CONCLUSIONS	7
8.	RECOMMENDATIONS	8
	LISTS IF ILLUSTRATIONS	
FIG	<u>URE</u>	
1.	OBJECTIVE TUBE ASSY	9
2.	ADAPTOR TUBE ASSY	10
3.	FIBER OPTIC CABLE	11
4.	OPTIONAL DESIGN ADAPTOR TUBE ASSY	12
5.	DOUBLE ECCENTRIC CONNECTOR	13
6.	TAPERED PLUGS ALIGNMENT	14

#### **ABSTRACT**

To control light loss in fiber connectors it was found that the centerline of one fiber core should be aligned with the centerline of the other fiber core. The means of obtaining this alignment and the transmission efficiency of light must be coordinated with the manufacturing efficiencies in order to obtain a practical connector design.

#### 1. PROBLEM STATEMENT

Existing borescopes for viewing cannon bores utilize illuminating heads with incandescent or fluorescent lamps. There is a safety hazard associated with high intensity incandescent bulb and electrical wiring e.g., heat and electrical shock. A new method is required using illuminators for use with fiber optic light guides to provide a convenient, safe and inexpensive source of intense illumination.

#### 2. BACKGROUND

Several firms are now engaged in the manufacture and sale of fiber optic materials and devices including: American Optical Company, American Cystoscope Makers Inc., Bausch and Lomb Inc., Valtec Corp and Optics Technology Inc. Light guides are used in many applications where there is a need to carry light from one point to another. Industry uses the light devices to examine the interior surfaces of pipes, tubing, checking malfunction in gage valves and inspecting the inner surface of various containers.

Therefore, it was considered desirable to determine if a relative simple method could be devised to couple the fiber optic light guides to the illuminators and an outside light source which will transmit cold light and be capable of supplying multiple levels of illumination from a white light source.

#### 3. APPROACH

Investigate the various suppliers of fiber optics for optimum type of fiber (plastic-glass) to provide for the lowest possible loss in light transmission. Since loss characteristics are directly related to accurate alignment of the fiber, particular design consideration was given to three critical areas:

- 1. Lateral Displacement
- 2. Angular Displacement
- 3. End Separation

Design of equipment to incorporate low light loss can be attained by using a floating alignment bushing made of polymeric material and a spring retainer device in each channel which maintains the required separation, absorbs connector contact channel tolerance compensated. The performance of any one given channel is therefore independent of the tolerance build-up of any other channel. Figures 1, 2, 3 and 4 dipict the design configuration that would be followed to produce a prototype fiber optic borescope. The incorporation of light conducting fiber in lieu of electrical wiring in the borescope will remove the risk of electrical shock to the operator. The use of fiber optics allow the hot external light source to be shielded and cooled without the constraints associated with the hot incandescent lamps.

#### 4. EQUIPMENT USED

The equipment used for the investigation was limited to the illuminators and fiber light pipes on hand. Aquisition of major items was curtailed by the re-routing of funds from this project to the (MRB) Magnetic Recording Borescope project being administered by (APG) Aberdeen Proving Ground.

#### SYSTEM FUNCTION

The system is designed and engineered for use with high intensity illuminators. The illuminator is a compact device which features a fiber optic light pipe adaptor for quick disconnect conversions, quick twist knob for easy access to lamp replacement, on/off toggle switch, cooling fan and variable light rheostat.

The light transmitted from the illuminator through the light pipes is coupled to a mating adaptor on the annulus ring light.

Light is concentrated accurately upon the proximal glass fiber bundles which are contained in the borescope tubular section. Provision is made in the illuminator to vary lamp voltage which is deemed necessary to vary intensity of light to obtain optimum illumination for viewing various cannon tube bores.

Intense cold light is provided where it is needed the most and that is where the mirror is located at the objective end of the borescope. The highly flexible fiber optic branches (tubes) can be directed to provide near shadowless illumination at the desired point of view.

#### 6. TEST RESULTS AND EVALUATION

The testing and evaluation of the fiber optic illuminating system consisted mainly of experimenting with on-hand equipment. Considerable time and effort was spent in determining light losses in single fiber terminations. Accordingly, the experimental phase of this project was limited to providing even illumination through a seven foot long borescope.

Evaluation of the illumination system shows that while good, permanent end splices of fiber connectors are available, separable connectors are hard to find. To control as much loss as possible in the connector, the following designs are being considered:

- a. Double Eccentric Connector, (figure 5). By rotating the different eccentric sections of the connector the fiber cores axes can be brought into very close alignment, thus it can be concluded that lowest possible losses can be obtained.
- b. Tapered Plug Connector, (figure 6). This connector design uses an index matching material to eliminate fiber interface losses. The axial concentricity tolerance build-up includes the path from core to fiber cladding, cladding to plug taper, plug alignment taper to biconical sleeve taper, alignment of the biconical taper themselves, and back down again to the other fiber core axis. Any rotation of the parts must show minimal excursion of the fiber central axis.

#### 7. CONCLUSIONS

This limited investigation has shown that no matter what the fiber size or type, all approaches to separable connectors for fiber optics have the same type of problems. The centerline of one fiber core should be aligned with the centerline of the other fiber core. Every connector design has as its objective the axis alignment with the highest degree of accuracy possible. The means of obtaining this alignment and the transmission efficiency of light must be coordinated with the manufacturing method efficiencies in order to obtain a practical connector design.

#### 8. RECOMMENDATIONS

Based on the results of this limited investigation, it is recommended that an optical self-centering, overlap style connector be designed to hold within reasonable levels, the coupling losses attributed to fiber core diameter variation, core axial displacement, and angular misalignment without the need for special or difficult to control manufacturing or assembly methods. It is also recommended that the fiber optic illumination system be limited to a seven foot borescope length which can be used to visually inspect the cannon tubes bores of the following weapons; 60MM, 81MM, 4.2 inch mortar system, 90MM, 106MM recoilless rifle systems and chamber and origin of rifling of all cannon tubes.

Performance evaluation of the illuminating system is favorable for continued development efforts. It is recommended that studies and work be continued on design refinement and the preparation of product engineering drawing for the acquisition of illuminating fiber optic systems.


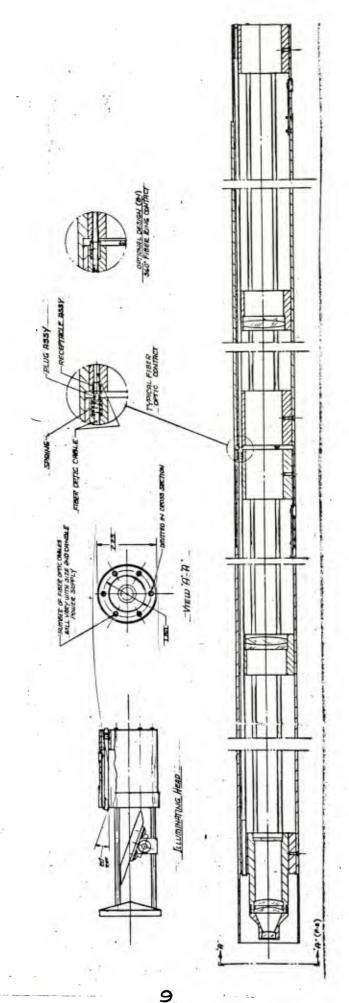


FIGURE-1


REAR FIBER SUPPORT BUSHING FIGURE-2 - EYE-PIECE TUBE LOCK RING COMPLETE BORESCOPE CONSIST OF-ADAPTER TUBE, SEXTENSION TUBES AND OBJECTIVE TUBE

TOTAL LENGHT=(26.3) WITH 9 CONTACTS ADAPTOR TUBE ASSEMBLY EIBER OPFIC. RETAINING CONNECTO BUSHING FIBER LOCK RING FRONT FIBER SUPPORT BUSHING ADAPTOR TUBE

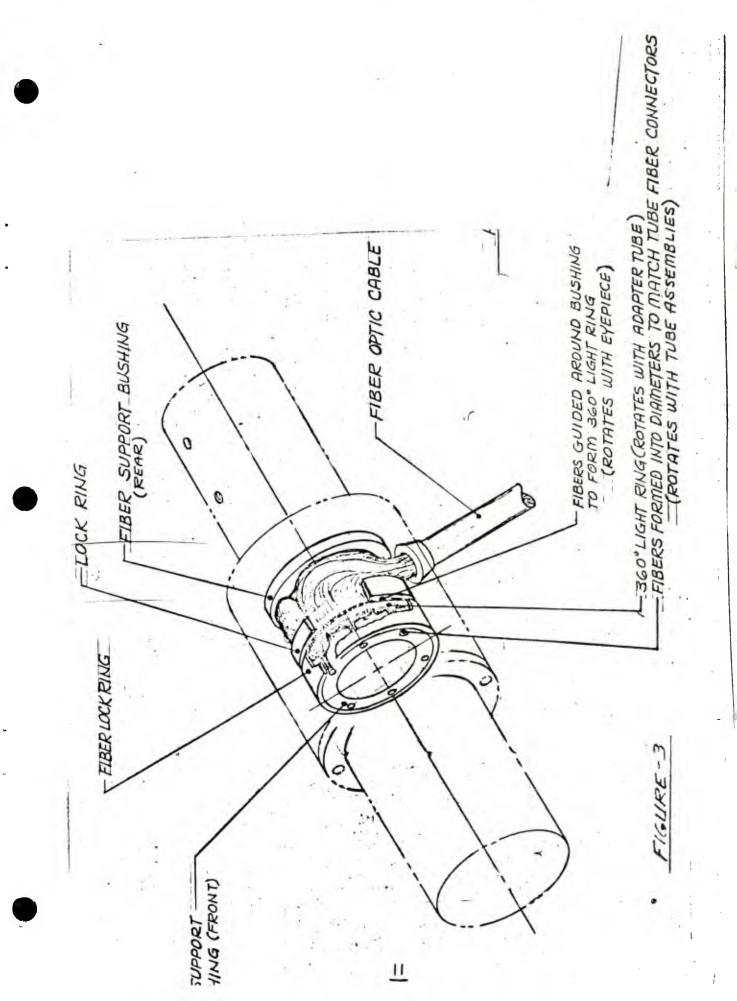


F16URE- 4

### DOUBLE ECCENTRIC CONNECTOR

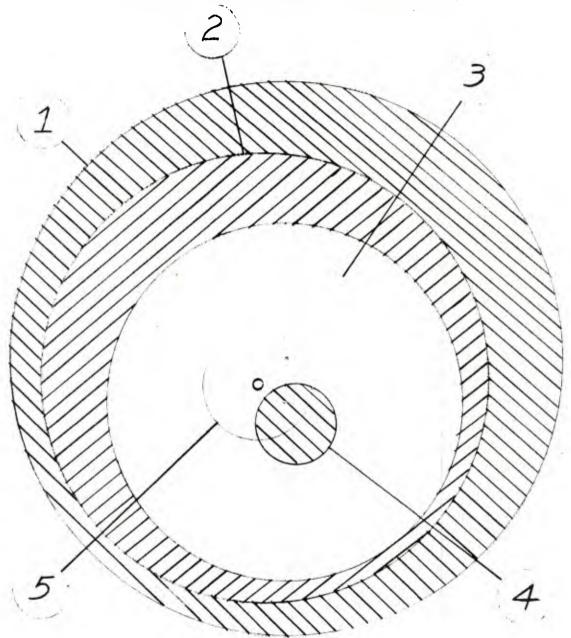

1. OUTER ECCENTRIC TUBE 2. INTERMEDIATE ECCENTRIC TUBE 3. INNER TUBE 4. OPTICAL FIBRE CORE 5. MOVABLE CORE CENTER AREA.

FIGURE - 5

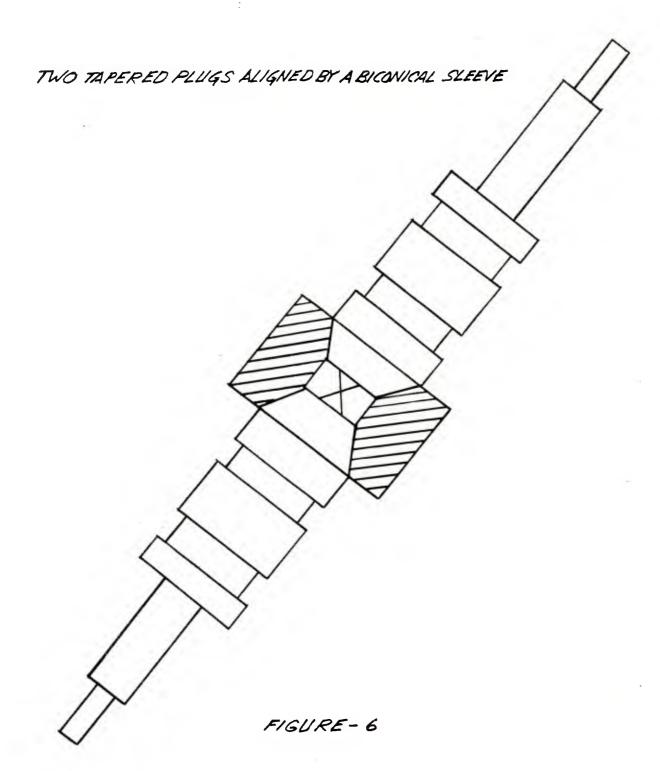

## ARMY MATERIALS AND MECHANICS RESEARCH CENTER WATERTOWN, MASSACHUSETTS 02172

## TECHNICAL REPORT DISTRIBUTION LIST FOR DARCOM MATERIALS TESTING TECHNOLOGY PROGRAM-

Distribution List approved by U. S. Army Materiel Development and Readiness Command, DRCQA, November 1977

Number of Copies	То
2	Metals and Ceramics Information Center, ATTN: Mr. Harold Mindlin, Director, and Mr. James Lynch, Assistant Director, 505 King Avenue, Columbus, Ohio 43201
12	Commander, Defense Documentation Center, Cameron Station, Alexandria, Virginia 22314
1	Commander, U. S. Army Foreign Science and Technology Center, ATTN: DRXST-SD3, 220 Seventh Street NE, Charlottesville, Virginia 22901
2.	Office of the Deputy Chief of Staff for Research, Development and Acquisition, ATTN: DAMA-ARZ-E, DAMA-CSS, Washington, DC 20310
2	Commander, Army Research Office, ATTN: Dr. George Mayer and Mr. J. J. Murray, P. O. Box 12211, Research Triangle Park, North Carolina 27709
6	Commander, U. S. Army Materiel Development and Readiness Command, ATTN: DRCQA-E; DRCQA-P; DRCDE-D; DRCDMD-FT; DRCLDC; DRCMT, DRCMM-M Alexandria, Virginia 22333
2 .	Commander, U. S. Army Electronics Command, ATTN: DRSEL-PA-E, Mr. Stan Alster, Fort Monnouth, New Jersey 07703
8	Commander, U. S. Army Missile Research and Development Command, ATTN: DRDMI-TB, Redstone Scientific Information Center (2 copies): (1 copy) DRDMI-TK, Mr. J. Alley; DRSMI-M; DRDMI-ET, Mr. Robert G. Black; DRDMI-QS, Mr. George L. Stewart, Jr.; DRDMI-EAT, Mr. R. Talley; DRDMI-QP; Redstone Arsenal, Alabama 35809
3	Commander, U. S. Army Troop Support and Aviation Materiel Readiness Command, ATTN: DRSTS-PLE, Mr. J. Corwin (1 copy); (1 copy each) DRSTS-Q and DRSTS-M, 4500 Goodfellow Boulevard, St. Louis, Missouri 63120
1	Commander, U. S. Army Natick Research and Development Command,

ATTN: DRXXM-EM, Natick, Massachusetts 01760

,	Copies	To
9		Commander, U. S. Arry Mobility Equipment Research and Development Command, ATTN: DRDME-D; DRDME-L; DRDME-G; DRDME-H; DRDME-H; DRDME-T; DRDME-TQ, DRDME-V; DRDME-ZE; DRDME-N Fort Belvoir, Virginia 22060 ~
2		Commander, U. S. Army Tank-Automotive Materiel Readiness Command, ATTN: DRSTA-Q, Warren, Michigan 48090
6		Commander U. S. Army Armament Materiel Readiness Command, ATTN: DRSAR-QA, (2 copies): (1 copy each) DRSAR-SC; DRSAR-RDP; DRSAR-EN; DRSAR-QAE, Rock Island, Illinois 61201
12		Commander, U. S. Army Armament Research and Development Command, ATTN: DRDAR-LC, Mr. E. Kelly (1 copy) DRDAR-LCA, Dr. Sharkoff (1 copy) DRDAR-LCE, Dr. Walker (1 copy) DRDAR-QAS, Mr. F. Fitzsimmons (5 copies) DRDAR-SCM, Jr. J. Corrie (1 copy) DRDAR-TSP, Mr. B. Stephans (1 copy) DRDAR-TSS, (STINFO) (2 copies) Dover, New Jersey 07801
2		Commander, Edgewood Arsenal, ATTN: DRDAR-CLR, Mr. Montaway (1 copy), DRDAR-QAC, Dr. Moritz (1 copy), Aberdeen Proving Ground, Maryland 2101
1'		Commander, Watervliet Arsenal, ATTN: DRDAR-LCB, Mr. T. Moraczewski, Watervliet, New York 12189
4		Commander, U. S. Army Aviation R&D Command, ATTN: DRDAV-EXT; DRDAV-QR; DRDAV-QP; DRDAR-QE; St. Louis, Missouri 63166
6	*	Commander, U. S. Army Tank-Automotive Research and Development Command ATTN: DRDTA-RKA, Mr. D. Matichuk (1 copy) DRDTA-RKA, Mr. R. Dunec (1 copy) DRDTA-RKA, Mr. S. Catalano (1 copy) DRDTA-RH, Mr. O. Renius (1 copy) (Just Infrared, Ultrasonic and Holographic Reports) DRDTA-JA, Mr. C. Kedzior (1 copy) DRDTA-UL (Tech Library) (1 copy) Warren, Michigan 48090
1		Director, U. S. Army Industrial Base Engineering Activity, ATTN: DRXPE-MT, Dr. W. T. Yang, Rock Island, Illinois 61201
1		Commander, Harry Diamond Laboratories, ATTN: DRXDO-EDE, Mr. B. F. Willis, 2800 Powder Mill Road, Adelphi, Maryland 20785
2		Commander, U. S. Army Test and Evaluation Command, ATTN: DRSTE-TD; DRSTE-ME, Aberdeen Proving Ground, Maryland 21005
3		Commander, U. S. Army White Sands Missile Range, ATTN: STEWS-AD-L:

STEWS-ID; STEWS-TD-PM, White Sands Missile Range, New Mexico 88002

Number of Copies	То
1	Commander, U. S. Army Yuma Proving Ground, ATTN: Technical Library, Yuma, Arizona 85364
1	Commander, U. S. Army Tropic Test Center, ATTN: STETC-TD, Drawer 942, Fort Clayton, Canal Zone
4 .	Commander, Aberdeen Proving Ground, ATTN: STEAP-MT; STEAP-TL; STEAP-MT-M, Mr. J. A. Feroli; STEAP-MT-G, Mr. R. L. Huddleston; Aberdeen Proving Ground, Maryland 21005
1	Commander, U. S. Army Cold Region Test Center, ATTN: STECR-OP-PM, APO Seattle, Washington 98733
1	Commander, U. S. Army Dugway Proving Ground, ATTN: STEDP-MT, Dugway, Utah 84022
1	Commander, U. S. Army Electronic Proving Ground, ATTN: STEEP-MT, Ft. Huachuca, Arizona 85613
, 1	Commander, Jefferson Proving Ground, ATTN: STEJP-TD-I, Madison, Indiana 47250
	Commander, U. S. Army Aircraft Development Test Activity, ATTN: STEBG-TD, Ft. Rucker, Alabama 36362
- 1	President, U. S. Army Armor and Engineer Board, ATTN: ATZKOAE-TA, Ft. Knox, Kentucky 40121
1	President, U. S. Army Field Artillery Board, ATTN: ATZR-BDOP, Ft. Sill, Oklahoma 73503
1	Commander, Anniston Army Depot, ATTN: SDSAN-QA, Anniston, Alabama 36202
1 .	Commander, Corpus Christi Army Depot, SDSCC-MEE, Mr. Haggerty, Mail Stop 55, Corpus Christi, Texas 78419
1	Commander, Letterkenny Army Depot, ATTN: SDS-LE-QA, Chambersburg, Pennsylvania 17201
1	Commander, Lexington-Bluegrass Army Depot, ATTN: SDSRR-QA, Lexington, Kentucky 40507
1	Commander, New Cumberland Army Depot, ATTN: SDSNC-QA, Kew Cumberland, Pennsylvania 17070
2	Commander, U. S. Army Depot Activity, Pueblo, ATTN: SDSTE-PU-Q, Pueblo, Colorado 81001

aber or Copier	То
1	Commander, Red River Army Depot, ATTN: SDSRR-QA, Texarkana,  Texas 75501
1	Commander, Sacramento Army Depot, ATTN: SDSSA-QA, Scaramento, California 95813
1	Commander, Savanna Army Depot Activity, ATTN: SDSSV-S, Savanna, Illinois 61074
1	Commander, Seneca Army Depot, ATTN: SDSSE-R, Romulus, New York 14541
1	Commander, Sharpe Army Depot, ATTN: SDSSH-QE, Lathrop, California 95330
1	Commander, Sierra Army Depot, ATTN: SDSSI-DQA, Herlong, California 961:
1	Commander, Tobyhanna Army Depot, ATTN: SDSTO-Q, Tobyhanna, Pennsylvania 18466
1	Commander, Tooele Army Depot, ATTN: SDSTE-QA, Tooele, Utah 84074
1	Director, DARCOM Ammunition Center, ATTN: SARAC-DE, Savanna, Illinois 61074
2	Naval Research Laboratory, ATTN: Dr. J. M. Krafft, Code 8430; Library, Code 2620; Washington, DC 20375
3	Director, Air Force Materiel Laboratory, ATTN: AFML-DO, Library; AFML-LTM, Mr. E. Wheeler; AFML-LLP, Mr. R. Rowand; Wright-Patterson AFB, Ohio 45433
9	Director, Army Materials and Mechanics Research Center, ATTN: DRXMR-P (1 copy)     DRXMR-PL (2 copies)     DRXMR-M (2 copies)     DRXMR-MQ (1 copy)     DRXMR-MI, Mr. Darcy (1 copy)     DRXMR-L; Dr. Chait (1 copy)     DRXMR-RA, Mr. Valente (1 copy)